

Reference Information:

OEM PN: 6R914
 OEM Yield: 6,000
 @ 5% coverage

Approximate Remanufacturing

Time: 10-15 minutes

Recommended Tools:

Phillips-head screwdriver
 Small, flat-head screwdriver

Materials Needed:

Soft, lint-free cloths P/N:99CL14
 Oasis Toner P/N: XDTN10220
 Oasis Developer P/N: XDTN77190

Toner Unit Disassembly

1. Remove two screws that connect the waste bin to the toner hopper shown in Fig. 1.

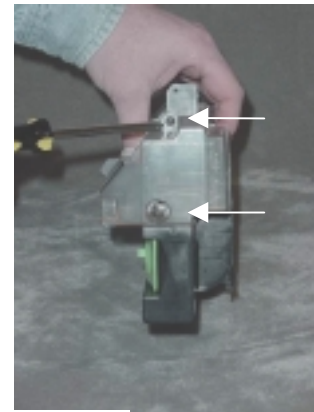


Fig. 1

2. Remove the waste bin as shown in Fig. 2.



Fig. 2

3. Remove The two screws that secure the end cap to the toner hopper (Fig. 3).

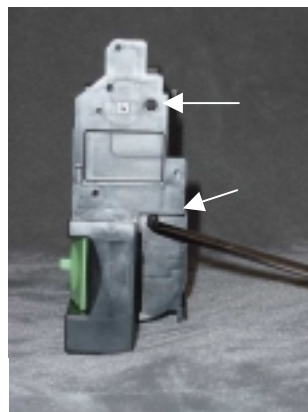


Fig. 3

4. Pull the end cap toward the front of the hopper. There are two locking clips that will release and allow you to remove the end cap.



5. Remove two screws that connect the developer section to the toner hopper shown in Figure 5.

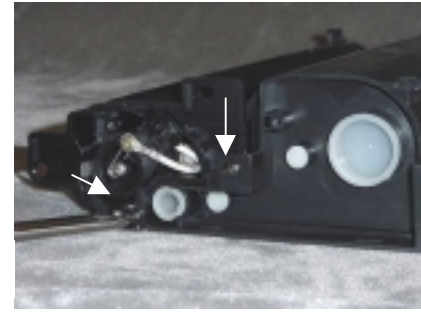


Fig. 5

6. Once the screws are removed, separate the two halves by pulling the developer section away from the toner hopper.



7. Carefully remove the hopper cap (Large) and developer cap (small). Clean both areas with compressed air. Clean the developer section (roller) also, removing all existing developer.

7a. Replace Toner with Oasis **XDTN10220**.
Replace Developer with Oasis **XDTN77190**.

8. Reassemble the cartridge in reverse order to insure proper assembly.

